






Assessment Campus Linked Bldg Addition Room Assessment Assessment Description **Building System Building System Building System Building System** Priority **Facility Condition** Quantity **Unit Cost** Unit Of Measure | Estimated Cost ID System Year Status L2 L3 L4 3402 Hoover-Wood 779 - Exterior Exterior 2020 Flashing at base of wall: poor along | Shell Exterior Vertical Exterior Walls Exterior Wall 1-Must Do 187 \$40 Linear Foot \$7,480 Sent to Poor School Face Brick Maintenance plan south and east side of building **Enclosures** Veneer Parking Lots 3408 904 - Sitework, 2020 Sent to Parking Lot 1-Must Do Poor 64400 \$6 \$386,400 Hoover-Wood Per Capital Project Plan - replace Sitework Square Foot Parking Lot Improvements School Maintenance north and south parking lots; **Pavement** installed in 2001 and in poor Pavement condition. Cost is for full depth replacement of standard-duty (SD) asphalt paving. 64 \$6 3498 Hoover-Wood 1143 - Interior Storage 160 2020 Sent to Missing wall base throughout room Interiors Interior Finishes Wall Finishes 1-Must Do Poor Linear Foot \$384 School Wall Finishes, Maintenance Storage 160 Wall Base 3500 Hoover-Wood 883 - Ceilings, Storage 160 2020 Sent to Almost every tile ripped from tape. Interiors Interior Suspended Ceiling Acoustical 1-Must Do Poor 206 \$8 Square Foot \$1,545 Maintenance Construction Construction Suspended School Acoustical Suspended Storage 160 Ceilings Systems Cost is for system replacement. Wall Painting and 1-Must Do 2020 Wall Finishes 206 \$1 \$185 3502 Hoover-Wood 1091 - Interior Room 160 Sent to Chipped, very dirty in Room 160 Interiors Interior Finishes Poor Square Foot School Wall Finish, Paint Maintenance Coating Interior Finishes Flooring 3567 896 - Flooring, 2020 Sent to Interiors Resilient Flooring 1-Must Do 42 Square Foot \$294 Hoover-Wood Storage 145 Storage 145 Poor VCT Maintenance School Cost is to replace VCT in kind. 896 - Flooring, 2020 Sent to Storage 218 Resilient Flooring 1-Must Do 123 \$861 3588 Hoover-Wood Storage 218 Interiors Interior Finishes Flooring Poor Square Foot VCT School Maintenance Cost is to replace VCT in kind. Hoover-Wood 2020 Boys 123 ACT poor - lots of water Suspended Ceiling Acoustical 1-Must Do 256 \$8 \$1,920 3612 883 - Ceilings, Boys 123 Sent to Square Foot Interiors Interior Poor Maintenance damaged tiles. See photos. Construction Construction Suspended School Acoustical Suspended Ceilings Systems 2020 Interior Finishes Wall Finishes Wall Painting and 1-Must Do \$1 \$111 3622 Hoover-Wood 1091 - Interior Storage 218 Paint poor in Storage 218 Interiors 123 Square Foot Sent to Poor Wall Finish, Paint School Maintenance Coating 2020 300 \$15 3624 Hoover-Wood 922 - Interior 211 Sent to GWB ripped on every wall in pull out Interiors Interior Interior Partitions Interior Fixed 1-Must Do Poor Square Foot \$4,500 School Partitions, Fixed-Maintenance 211. Quantity reflects perimeter of Construction **Partitions GWB** room multiplied by assumed height. Cost is to replace GWB. 3658 Hoover-Wood 2020 Sent to Interior Doors Interior Swinging 1-Must Do \$2,600 Each \$10,400 Gym HM frames at gym doors to exterior Interiors Interior Poor Maintenance have a lot of rust at base of frame, 2 Construction School Doors, Swinging-Doors Hollow Metal pair. See photos. Cost is for replacement of frame, doors and hardware. 3895 900 - Interior Wall Pullout 211 2020 Paint in poor condition, lots of tacky Interiors Interior Finishes Wall Finishes Wall Painting and 1-Must Do 120 \$1 \$108 Hoover-Wood Sent to Poor Square Foot Coating School Finish, Paint Maintenance left on all walls. Pullout 211 3903 MP Room 2020 Exterior HM door frame at door E4 Shell Exterior Entrance 1-Must Do \$2,600 \$2,600 784 - Exterior **Exterior Doors** Fach Hoover-Wood Sent to Exterior Vertical Poor and Grilles Entrance Doors, Maintenance seriously rusted at bottom. Enclosures School Doors Hollow Metal MP Room Cost is to replace frame, door and hardware.

Building Our Future
TOGETHER
BPS
101



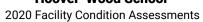





| sessment | Campus | Linked Bldg | Addition | Room | Assessment | Assessment | Description | Building System | Building System | Building System | Building System | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cos |
|-------------------|-----------------------|--|----------|--------------------------------|------------------|------------------------|--|---------------------------|---------------------------------|-----------------------------------|------------------------------|-------------|---------------------------|----------|-----------|-----------------|---------------|
| ID 3904 | Hoover-Wood School | System 784 - Exterior Entrance Doors, Hollow Metal | | MP Room | Year 2020 | Sent to Maintenance | Exterior HM doors in fair condition. MP Room | Shell | Exterior Vertical Enclosures | Exterior Doors and Grilles | Exterior Entrance Doors | 1-Must Do | Poor | 2 | \$2,600 | Each | \$5,200 |
| | | | | | | | Cost is to replace frame, doors and hardware. | | | | | | | | | | |
| 3905 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | MP Room | 2020 | Sent to Maintenance | Interior wood doors in fair condition. MP Room | Interiors | Interior Construction | Interior Doors | Interior Swinging Doors | 1-Must Do | Poor | 2 | \$1,950 | Each | \$3,900 |
| | | | | | | | Cost is to replace wood doors and | | | | | | | | | | |
| 5583 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Storage 219 | 2020 | Sent to Maintenance | CMU in poor condition. Cracking at corners, stair step cracks. See photos | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 1-Must Do | Poor | 50 | \$0 | Linear Foot | \$0 |
| 3404 | Hoover-Wood School | 779 - Exterior Face Brick | | | 2020 | Sent to Maintenance | Flashing at base of wall: fair along plan north side of building and along curved classroom portion, no large sections of major damage | Shell 3 | Exterior Vertical Enclosures | Exterior Walls | Exterior Wall Veneer | 2-Should Do | Fair | 650 | \$40 | Linear Foot | \$26,000 |
| 3406 | Hoover-Wood School | 2423 - Exterior Limestone Sills | | | 2020 | Sent to Maintenance | All limestone window sills throughout building are stained but have no other visible damage. Quantity approximates 2 SF per sill (36 sills). | Shell | Exterior Vertical Enclosures | Exterior Walls | Exterior Wall Veneer | 2-Should Do | Fair | 72 | \$5 | Square Foot | \$360 |
| 3411 | Hoover-Wood School | 907 - Sitework, Pedestrian Pavement | | Exterior, Pedestrian Paving | 2020 | Sent to Maintenance | Pooling and cracking at paved site access, hard surface playground | Sitework | Site Improvements | Pedestrian Plazas and Walkways | Pedestrian Pavement | 2-Should Do | Fair | 26500 | \$6 | Square Foot | \$159,000 |
| 3414 | Hoover-Wood School | 784 - Exterior Entrance Doors, Hollow Metal | | | 2020 | Sent to Maintenance | Flashing damaged or separating from lintel at exterior hollow metal doors, especially at doors facing playgrounds (gym, multipurpose, classroom 133). Also at door S1. | Shell | Exterior Vertical Enclosures | Exterior Doors and Grilles | Exterior Entrance Doors | 2-Should Do | Fair | 38 | \$40 | Linear Foot | \$1,520 |
| 3418 | Hoover-Wood School | 901 - Fixed Equipment, Casework | | Office | 2020 | Sent to Maintenance | Laminate chipped and peeling on reception desk. See photos. Admin Office 180 | Equipment and Furnishings | Furnishings | Fixed Furnishings | Casework | 2-Should Do | Fair | 27 | \$800 | Linear Foot | \$21,600 |
| | | | | | | | Cost is for replacement in kind. | | | | | | | | | | |
| 3426 | Hoover-Wood School | 903 - Flooring, Carpet | | Office | 2020 | Sent to Maintenance | Carpet worn and discolored throughout admin office suite in major traffic areas. | Interiors | Interior Finishes | Flooring | Carpeting | 2-Should Do | Fair | 2000 | \$12 | Square Foot | \$24,000 |
| | | | | | | | Rooms: Office 180, Office 178, Storage 177, Conference 176, Office 175, Work Room 174 | | | | | | | | | | |
| | | | | | | | Cost is to replace with rubber. | - | | | | | | | 4- | | 4 |
| 3442 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Office | 2020 | Sent to Maintenance | Wall base in fair condition - Nothing peeling or seriously damaged, but pretty scuffed throughout entire admin office suite. | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair | 600 | \$6 | Linear Foot | \$3,600 |
| | | | | | | | | | | | | | | | | | |
| 3452 | Hoover-Wood School | 922 - Interior Partitions, Fixed- GWB | | Office | 2020 | Sent to Maintenance | Assumes replacement with flooring. GWB dented and scuffed. Nurse 168, Storage 172 | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair | 0 | \$15 | Square Foot | \$0 |










| 1- | | | | | T | | | | | | 2 2 2 2 2 | | - III 6 III | | | | T 10 . |
|-----------------|-----------------------|---------------------------------|----------|---------------|--------------------|------------------------|--|------------------------------|-----------------------|-----------------------|-----------------------|--------------|--------------------|----------|-----------|-----------------|----------------|
| Assessmen ID | t Campus | Linked Bldg System | Addition | Room | Assessment Year | Assessment Status | Description | Building System L1 | Building System L2 | Building System L3 | Building System L4 | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
| 3466 | Hoover-Wood | 1091 - Interior | | Storage | 2020 | Sent to | Paint is very dirty on CMU walls, but | | | Wall Finishes | Wall Painting and | 2-Should Do | Fair | 105 | \$1 | Square Foot | \$95 |
| | School | Wall Finish, Paint | | | | Maintenance | not chipped. | | | | Coating | | | | 7- | | 723 |
| | | | | | | | Storage 167 | | | | | | | | | | |
| 3467 | Hoover-Wood | 896 - Flooring, | | Storage | 2020 | Sent to | VCT in storage is very dirty and | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair | 400 | \$7 | Square Foot | \$2,800 |
| | School | VCT | | | | Maintenance | scuffed. | | | | | | | | | | |
| | | | | | | | Storage 167, 152, 150, 119, 131, | | | | | | | | | | |
| | | | | | | | Copier 158 | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | |
| | | | | | | | Cost is to replace VCT in kind. | | | | | | | | | | |
| 3469 | Hoover-Wood | 896 - Flooring, | | Corridors | 2020 | Sent to | scuffed, discolored, cracked | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair | 5200 | \$12 | Square Foot | \$62,400 |
| | School | VCT | | | | Maintenance | throughout hallway | | | | | | | | | | |
| | | | | | | | Cost is to replace VCT with rubber. | | | | | | | | | | |
| 3480 | Hoover-Wood | 896 - Flooring, | | Instructional | 2020 | Sent to | VCT dirty, cracked, scuffed | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair | 16000 | \$12 | Square Foot | \$192,000 |
| 0.00 | School | VCT | | Spaces | | Maintenance | throughout room. Room 165 missing | | | | | 2 004.4 20 | | 10000 | Y | Square : SSt | Ψ 23 2,000 |
| | | | | | | | one tile under UV. | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | |
| | | | | | | | Rooms: 165 (D.O.), 164, 163, 159 | | | | | | | | | | |
| | | | | | | | (music), 155 (art), 135, 134, 108, | | | | | | | | | | |
| | | | | | | | 109, 115 (pull out), 110, 107, 106, 105, 113 (pull out), 104, 1102 (pull | | | | | | | | | | |
| | | | | | | | out), 103, 102, 101, 141 (OT/PT), 130 | | | | | | | | | | |
| | | | | | | | (pull out), 129 (reading), 128 | | | | | | | | | | |
| | | | | | | | (psych), 124 (ESL), 125 (Instructional | | | | | | | | | | |
| | | | | | | | Coach) | | | | | | | | | | |
| 3486 | Hoover-Wood | 901 - Fixed | | Classroom | 2020 | Sent to | Laminate on casework starting to | Equipment and | Furnishings | Fixed Furnishings | Cacawark | 2-Should Do | Fair | 24 | \$800 | Linear Foot | \$19,200 |
| 3400 | School | Equipment, | | Classiooni | 2020 | Maintenance | Laminate on casework starting to chip/peel, looks a little discolored, | Equipment and Furnishings | Furnishings | rixeu rumisiings | Casework | 2-3110010 D0 | raii | 24 | \$800 | Linear Foot | \$19,200 |
| | 3611001 | Casework | | | | - Ivianice | missing sealant at backsplash, | 1 4111131111183 | | | | | | | | | |
| | | | | | | | missing a couple pulls. Special Ed DO | | | | | | | | | | |
| | | | | | | | 165 | | | | | | | | | | |
| 3487 | Hoover-Wood | 1143 - Interior | | Classroom | 2020 | Sent to | Wall base scuffed. 165 Special Ed DO | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair | 117 | \$6 | Linear Foot | \$702 |
| | School | Wall Finishes, Wall Base | | | | Maintenance | | | | | | | | | | | |
| 3489 | Hoover-Wood | 787 - Interior | | Storage | 2020 | Sent to | Door frame scuffed, paint chipped | Interiors | Interior | Interior Doors | Interior Swinging | 2-Should Do | Fair | 3 | \$60 | Each | \$180 |
| 3403 | School | Doors, Swinging- | | Storage | 2020 | Maintenance | at Storage 152, 150, 119 | interiors | Construction | interior boors | Doors | 2 Should bo | T dil | 3 | 700 | Lucii | 7100 |
| | | Wood | | | | | | | | | | | | | | | |
| | | | | | | | Prep surface and provide new paint | | | | | | | | | | |
| | | | | | | | finish on frame. | | | | | | | | | | |
| 3591 | Hoover-Wood | 896 - Flooring, | | Classrooms | 2020 | Sent to | VCT dirty, cracked, scuffed | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair | 6100 | \$12 | Square Foot | \$73,200 |
| | School | VCT | | | | Maintenance | throughout room. | | | | | | | | | | |
| | | | | | | | Rooms: 208, 212 (pull out), 207, 206, | | | | | | | | | | |
| | | | | | | | 211 (pull out), 205, 204, 203, 210 | | | | | | | | | | |
| | | | | | | | (pull out), 201 | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | |
| 2507 | | 004 51 : | | - | 2020 | | Cost is to replace VCT with rubber. | | | | | 2.61 | | | 420 | | 427.000 |
| 3597 | Hoover-Wood School | 894 - Flooring, Ceramic Tile | | Toilets | | Sent to Maintenance | Faculty Toilet (in office), Nurse Toilet, Girls 162, Boys 123, Girls 122, | Interiors | Interior Finishes | Flooring | Tile Flooring | 2-Should Do | Fair | 900 | \$30 | Square Foot | \$27,000 |
| | 3011001 | Ceramic me | | | | ivialifice | Toilet 139, Toilet 132, Toilet 126 | | | | | | | | | | |
| | | | | | | | 35 252, 15325 252, 15335 220 | | | | | | | | | | |
| | | | | | | | Cost is to replace tile in kind. | | | | | | | | | | |
| 3598 | Hoover-Wood | 894 - Flooring, | | Toilets | 2020 | Sent to | Boys 214, Girls 213, Toilet 217 | Interiors | Interior Finishes | Flooring | Tile Flooring | 2-Should Do | Fair | 500 | \$30 | Square Foot | \$15,000 |
| | School | Ceramic Tile | | | | Maintenance | Cost is to wonloop tile in him d | | | | | | | | | | |
| | | | | | | | Cost is to replace tile in kind. | | | | | | | | | | |

3 of 14



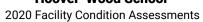




| Building Our TOGETHER | BPS 101 |
|--------------------------|---------|
| | |

| Access | Comment | Linked Bldg | Addition | Dec | Λος ος στο στ | Access====== | Description | Duilding Contact | Building System | Duilding Contact | Building System | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|------------------|-----------------------|---------------------------------------|----------|--------------|--------------------|------------------------|---|------------------|-------------------|---------------------|--------------------|--------------|--------------------|----------|-----------|-----------------|----------------|
| Assessment ID | Campus | System | Addition | Room | Assessment Year | Assessment Status | Description | L1 | L2 | L3 | L4 | Priority | racility Condition | Quantity | Unit Cost | Unit Of Weasure | Estimated Cost |
| 3599 | Hoover-Wood | 896 - Flooring, | | Stage | 2020 | Sent to | Stage | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair | 623 | \$12 | Square Foot | \$7,476 |
| | School | VCT | | 3.1.0 | | Maintenance | | | | | | | | | ľ | | |
| | | | | | | | Cost is to replace VCT flooring with | | | | | | | | | | |
| | | | | | | | rubber. | | | | | | | | | | |
| 3600 | Hoover-Wood | 896 - Flooring, | | Multipurpose | 2020 | Sent to | Multipurpose Room | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair | 2188 | \$12 | Square Foot | \$26,256 |
| | School | VCT | | Room | | Maintenance | Cook in the woodle on VCT with with an | | | | | | | | | | |
| 3601 | Hoover-Wood | 896 - Flooring, | | Corridors | 2020 | Sent to | Cost is to replace VCT with rubber. scuffed, discolored, cracked | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair : | 1500 | \$12 | Square Foot | \$18,000 |
| 3001 | School | VCT | | Corridors | 2020 | Maintenance | throughout hallway | interiors | interior rinishes | Tiooning | Resilient Hoofing | 2-Silodia Do | i an | 1300 | J12 | Square 100t | \$10,000 |
| | | | | | | | , | | | | | | | | | | |
| | | | | | | | Cost is to replace VCT with rubber. | | | | | | | | | | |
| 3602 | Hoover-Wood | 896 - Flooring, | | Storage 219 | 2020 | Sent to | Storage 219 | Interiors | Interior Finishes | Flooring | Resilient Flooring | 2-Should Do | Fair ! | 524 | \$7 | Square Foot | \$3,668 |
| | School | VCT | | | | Maintenance | | | | | | | | | | | |
| 3603 | Heaver Wood | 206 Flooring | | Gym | 2020 | Cant to | Cost is to replace VCT in kind. | Intoriors | Interior Finishes | Flooring | Resilient Flooring | 2 Should Do | Fair | 4391 | \$15 | Causes Foot | \$65,865 |
| 3003 | Hoover-Wood School | 896 - Flooring, VCT | | Gyiii | 2020 | Sent to Maintenance | scuffed, discolored, cracked in gym | interiors | Interior Finishes | Flooring | Resilient Flooring | 2-3110010 00 | raii | 4391 | \$15 | Square Foot | \$05,805 |
| | 3611001 | V C I | | | | Widirectionec | Cost is to replace with athletic | | | | | | | | | | |
| | | | | | | | flooring. | | | | | | | | | | |
| 3604 | Hoover-Wood | 895 - Flooring, | | Kitchen | 2020 | Sent to | Kitchen quarry tile is fair - dirty | Interiors | Interior Finishes | Flooring | Tile Flooring | 2-Should Do | Fair 2 | 242 | \$30 | Square Foot | \$7,260 |
| | School | Quarry Tile | | | | Maintenance | grout, tiles are worn and dirty | | | | | | | | | | |
| | | | | | | | Cost is to replace tile in kind. | | | | | | | | | | |
| 3606 | | 903 - Flooring, | | Classroom | 2020 | Sent to | Carpet appears worn, awkwardly | Interiors | Interior Finishes | Flooring | Carpeting | 2-Should Do | Fair ! | 562 | \$7 | Square Foot | \$3,653 |
| 3000 | | Carpet | | Classicom | 2020 | Maintenance | patched in one spot. See photo | interiors | interior rinishes | Tiooning | carpeting | 2-Silodia Do | i an | 302 | 71 | Square 100t | 73,033 |
| | School | | | | | | i · · · | | | | | | | | | | |
| | | | | | | | Computer Lab 118 | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | |
| 3617 | Haarran Maaad | 1091 - Interior | | Classrooms | 2020 | Sent to | Cost is to replace with carpet tile. Paint in all rooms fair. | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 2 Chauld Da | Fair : | 15100 | \$1 | Square Foot | \$13,590 |
| 3017 | Hoover-Wood School | Wall Finish, Paint | | Classioonis | 2020 | Maintenance | Rooms 165, 164, 163, 159, 155, 135, | interiors | interior rinishes | wall fillisties | Coating | 2-3110010 00 | rdii . | 13100 | \$1 | Square Foot | \$13,590 |
| | 3011001 | vvan i misn, i ame | | | | iviaiiiteilalice | 134, 108, 109, 115, 110, 107, 106, | | | | Coating | | | | | | |
| | | | | | | | 105, 113, 104, 112, 103, 102, 101, | | | | | | | | | | |
| | | | | | | | 130, 129, 128 | | | | | | | | | | |
| 3618 | Hoover-Wood | 1091 - Interior | | Classrooms | 2020 | Sent to | Paint in all rooms fair. | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 2-Should Do | Fair | 6700 | \$1 | Square Foot | \$6,030 |
| | School | Wall Finish, Paint | | | | Maintenance | Rooms 208, 212, 207, 206, 205, 204, | | | | Coating | | | | | | |
| 3619 | Hoover-Wood | 1091 - Interior | | Storage | 2020 | Sent to | 203, 202, 210, 201 Paint in most storage rooms fair | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 2-Should Do | Fair 6 | 600 | \$1 | Square Foot | \$540 |
| 3013 | School | Wall Finish, Paint | | Storage | 2020 | Maintenance | Tame in most storage rooms rain | Interiors | interior rimanes | wan i misries | Coating | 2 Should bo | l'un | 000 | 71 | Square 100t | 7540 |
| | | | | | | | Storage 145, 152, 150, 119, 131 | | | | Jan 6 | | | | | | |
| 3620 | Hoover-Wood | 1091 - Interior | | Kitchen | 2020 | Sent to | Paint in kitchen fair | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 2-Should Do | Fair 2 | 242 | \$1 | Square Foot | \$218 |
| | School | Wall Finish, Paint | | | | Maintenance | | | | | Coating | | | | 4. | | 4 |
| 3621 | Hoover-Wood | 1091 - Interior Wall Finish, Paint | | Multipurpose | 2020 | Sent to Maintenance | Paint fair for most of wall, poor at bottom of wall in MP room. Whole | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 2-Should Do | Fair | 2188 | \$1 | Square Foot | \$1,969 |
| | School | Wall Fillisti, Pallit | | Room | | Maintenance | room needs a touch up. | | | | Coating | | | | | | |
| 3623 | Hoover-Wood | 1091 - Interior | | LRC | 2020 | Sent to | Paint fair in Library Suite (library, | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 2-Should Do | Fair 2 | 2700 | \$1 | Square Foot | \$2,430 |
| | School | Wall Finish, Paint | | | | Maintenance | office 120). Quantity reflects SF of | | | | Coating | | | | ľ | • | . , |
| | | | | | | | spaces. | | | | | | | | | | |
| 3625 | Hoover-Wood | 922 - Interior | | Classrooms | 2020 | Sent to | GWB fair (dented in some areas, | Interiors | Interior | Interior Partitions | | 2-Should Do | Fair (| 0 | \$15 | Square Foot | \$0 |
| | School | Partitions, Fixed- | | | | Maintenance | ripped in a couple places, scuffed, | | Construction | | Partitions | | | | | | |
| | | GWB | | | | | but no major damage) in classrooms. | | | | | | | | | | |
| | | | | | | | Ciassi OUIIIS. | | | | | | | | | | |
| | | | | | | | Rooms 165, 164, 163, 159, 155, 135, | | | | | | | | | | |
| | | | | | | | 134, 108, 109, 115, 110, 107, 106, | | | | | | | | | | |
| | | | | | | | 105, 113, 104, 112, 103, 102, 101, | | | | | | | | | | |
| | | | | | | | Computer Lab 118, 128, 124, Office | | | | | | | | | | |

4 of 14



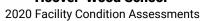






| Assessmen | t Campus | Linked Bldg | Addition | Room | Assessment | Assessment | Description | Building System | Building System | Building System | Building System | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cos |
|-----------|-----------------------|--|----------|------------|------------|------------------------|---|---------------------------|--------------------------|---------------------|------------------------------|-------------|--------------------|----------|-----------|-----------------|---------------|
| ID | | System | | | Year | Status | | L1 | L2 | L3 | L4 | | | | | | |
| 3629 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Classrooms | 2020 | Sent to Maintenance | Stair step cracking, crack through blocks, cracking at window sills in exterior walls of classrooms. ~10LF per room. | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair | 90 | \$15 | Linear Foot | \$1,350 |
| | | | | | | | Rooms 159, 164, 130, 109, 110, 106, 104, 103, 102 Cost is to repair step cracking only. | | | | | | | | | | |
| 3630 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Classrooms | 2020 | Sent to Maintenance | Stair step cracking, crack through blocks, cracking at window sills in exterior walls of classrooms. ~10LF cracking per room. Rooms 208, 207, 206, 205, 203, 202, 201 | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair | 70 | \$15 | Linear Foot | \$1,050 |
| 3631 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Storage | 2020 | Sent to Maintenance | Cost is to repair step cracking only. Minor cracking in Storage 218 Cost is to repair cracking only. | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair | 20 | \$15 | Linear Foot | \$300 |
| 3632 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | LRC | 2020 | Sent to Maintenance | Stair step cracking, crack through blocks, cracking at window sills, in corners of LRC. | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair | 100 | \$25 | Linear Foot | \$2,500 |
| 3633 | Hoover-Wood School | 901 - Fixed Equipment, Casework | | Classrooms | 2020 | Sent to Maintenance | Cost is to repair step cracking only. Casework fair, p-lam peeling, missing sealant at backsplashes, chipped, missing 1-2 pulls Rooms 165, 164, 163, 155, 135, 109, | Equipment and Furnishings | Furnishings | Fixed Furnishings | Casework | 2-Should Do | Fair | 325 | \$800 | Linear Foot | \$260,000 |
| 3634 | Hoover-Wood School | 901 - Fixed Equipment, Casework | | Classrooms | 2020 | Sent to Maintenance | 110, 107, 106, 104, 103, 101 Casework fair, p-lam peeling, missing sealant at backsplashes, chipped, missing 1-2 pulls Rooms 208,207, 206, 205, 204, 203, | Equipment and Furnishings | Furnishings | Fixed Furnishings | Casework | 2-Should Do | Fair | 150 | \$800 | Linear Foot | \$120,000 |
| 3636 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Classrooms | | Sent to Maintenance | Wall base scuffed significantly throughout room. Rooms 165, 164, 163, 159, 155, 135, 134, 108, 109, 115, 110, 107, 106, 105, 113, 104, 112, 103, 102, 101, Computer Lab 118, 130 | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair | 2000 | \$6 | Linear Foot | \$12,000 |
| 3637 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Classrooms | 2020 | Sent to Maintenance | Wall base scuffed significantly throughout room. Rooms 208, 212, 207, 206, 211, 205, 204, 203, 210, 201 | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair | 1136 | \$6 | Linear Foot | \$6,816 |

5 of 14



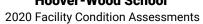




Print Date: 2/22/2021



| Assessmen ID | t Campus | Linked Bldg System | Addition | Room | Assessment Year | Assessment Status | Description | Building System L1 | Building System L2 | Building System L3 | Building System L4 | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cos |
|-----------------|-----------------------|---|----------|-------------------------|--------------------|------------------------|--|-----------------------|--------------------------|-----------------------------|---|-------------|--------------------|----------|-----------|-----------------|---------------|
| 3639 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | Classrooms | | Sent to Maintenance | HM door frames in fair condition, very scuffed at base, paint chipped. Rooms 165, 164, 163, 159, 155, 135, 134, 108, 109, 115, 110, 107, 106, | | Interior Construction | | Interior Swinging Doors | 2-Should Do | Fair | 30 | \$60 | Each | \$1,800 |
| | | | | | | | 105, 113, 104, 112, 103, 102, 101, 130, 129, 128, 124, 125, Computer Lab 118 Prep surface and provide new paint finish on frames. | | | | | | | | | | |
| 3640 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | Classrooms | | Sent to Maintenance | | Interiors | Interior Construction | | Interior Swinging Doors | 2-Should Do | Fair | 13 | \$60 | Each | \$780 |
| | | | | | | | Prep surface and provide new paint finish on frames. | | | | | | | | | | |
| 3642 | Hoover-Wood School | 990 - Electrical, Lighting Fixtures | | Instructional Spaces | | Sent to Maintenance | Lights in generally good condition (could be cleaned out, lots of bugs). Rooms 208, 212, 207, 206, 211, 205, | Services | Electrical | Lighting | Lighting Fixtures | 2-Should Do | Fair | 0 | \$0 | | \$0 |
| 2540 | | | | - 11 . | 2020 | | 204, 203, 210, 201 | | | | T 11 + D 11 1 | 2.61 11.5 | | | 44.000 | 5 1 | ÅF 400 |
| 3649 | Hoover-Wood School | 909 - Interior Specialties, Toilet Compartments | | Toilets | | Sent to Maintenance | Toilet partitions fair in Boys 123 Cost is to replace with solid phenolic (SPCP) partitions. | Interiors | Interior Construction | | Toilet, Bath, and Laundry Accessories | 2-Should Do | Fair | 3 | \$1,800 | Each | \$5,400 |
| 3652 | Hoover-Wood School | 898 - Interior Stair Finishes, Resilient | | Stage | | Sent to Maintenance | Rubber stair treads in fair condition up to stage, both sides. | Interiors | Interior Finishes | | Resilient Stair Finish | 2-Should Do | Fair | 100 | \$18 | Square Foot | \$1,800 |
| 3653 | Hoover-Wood School | 898 - Interior Stair Finishes, Resilient | | Stairs | 2020 | Sent to Maintenance | Rubber stair treads in fair condition at all stairwells. | Interiors | Interior Finishes | Stair Finishes | | 2-Should Do | Fair | 42 | \$90 | Each | \$3,780 |
| 3654 | Hoover-Wood School | 789 - Interior Partitions, Operable | | Stage | 2020 | Sent to Maintenance | | Interiors | Interior Construction | | Interior Operable Partitions | 2-Should Do | Fair | 42 | \$400 | Linear Foot | \$16,800 |
| 3656 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | Stage | 2020 | Sent to Maintenance | both sides of stage. Prep surface and provide new paint | Interiors | Interior Construction | | Interior Swinging Doors | 2-Should Do | Fair | 2 | \$60 | Each | \$120 |
| 3659 | Hoover-Wood School | 777 - Slab on Grade | | Corridor | | Sent to Maintenance | | Substructure | Slabs-On-Grade | Standard Slabs-on- Grade | | 2-Should Do | Fair | 25 | \$50 | Linear Foot | \$1,250 |
| 3662 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Gym | | Sent to Maintenance | | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair | 277 | \$6 | Linear Foot | \$1,662 |
| 3664 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | Storage | | Sent to Maintenance | Door slightly damaged at base, surface scuffed at Storage 152, 150, 119 | Interiors | Interior Construction | | Interior Swinging Doors | 2-Should Do | Fair | 3 | \$1,950 | Each | \$5,850 |
| | | | | | | | Cost is to replace with new door and hardware. | | | | | | | | | | |



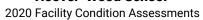





| Assessment ID | Campus | Linked Bldg System | Addition | Room | Assessmen Year | t Assessment Status | Description | Building System L1 | Building System L2 | Building System L3 | Building System L4 | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|------------------|-----------------------|---|----------|----------------------|-------------------|------------------------|---|------------------------------|--------------------------|-----------------------------------|---------------------------------------|-------------|--------------------|----------|-----------|-----------------|----------------|
| 3893 | Hoover-Wood School | 885 - Interior Railings and Handrails | | Stage, Stairwells | | Sent to Maintenance | Paint on handrails very chipped. Otherwise, structurally sound. Stage (both sides), both stairwells to second floor. Cost is to clean, prime and paint handrails. | Interiors | Interior Construction | Interior Specialties | Interior Railings and Handrails | 2-Should Do | Fair : | 125 | \$25 | Linear Foot | \$3,125 |
| 3897 | Hoover-Wood School | 901 - Fixed Equipment, Casework | | Kitchen | 2020 | Sent to Maintenance | Casework fair, missing pulls. Kitchen | Equipment and Furnishings | Furnishings | Fixed Furnishings | Casework | 2-Should Do | Fair : | 17 | \$800 | Linear Foot | \$13,600 |
| 3898 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Kitchen | 2020 | Sent to Maintenance | Tile wall base fair; approx. 70 LF, 6" high base Kitchen | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair 3 | 35 | \$30 | Square Foot | \$1,050 |
| 3901 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Multipurpose Room | 2020 | Sent to Maintenance | Wall base fair. MP Room | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair : | 192 | \$6 | Linear Foot | \$1,152 |
| 3902 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | Multipurpose Room | 2020 | Sent to Maintenance | Interior HM door frames fair, 2 pair MP Room Prep surface and provide new paint finish of frames. | Interiors | Interior Construction | Interior Doors | Interior Swinging Doors | 2-Should Do | Fair 4 | 4 | \$60 | Each | \$240 |
| 3906 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Multipurpose Room | 2020 | Sent to Maintenance | CMU cracking throughout. MP Room | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair ! | 50 | \$15 | Linear Foot | \$750 |
| 3909 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | LRC | 2020 | Sent to Maintenance | Cost is to repair cracking only. CMU cracking at corners. Library, Office 120 Cost is to repair cracking only. | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair : | 100 | \$15 | Linear Foot | \$1,500 |
| 3910 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | LRC | 2020 | Sent to Maintenance | Wood doors fair; 1 pair, 2 single openings. Library, Office 120 Cost is to replace doors and hardware. | Interiors | Interior Construction | Interior Doors | Interior Swinging Doors | 2-Should Do | Fair | 4 | \$1,950 | Each | \$7,800 |
| 3911 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | LRC | 2020 | Sent to Maintenance | HM door frames fair; 1 pair, 2 single openings. Library, Office 120 | Interiors | Interior Construction | Interior Doors | Interior Swinging Doors | 2-Should Do | Fair 4 | 1 | \$60 | Each | \$240 |
| | Hoover-Wood School | 901 - Fixed Equipment, Casework | | LRC | 2020 | Sent to Maintenance | Bookshelves and checkout desks in | Equipment and Furnishings | Furnishings | Fixed Furnishings | Casework | 2-Should Do | Fair 2 | 22 | \$800 | Linear Foot | \$17,600 |
| 3914 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Office | 2020 | Sent to Maintenance | Library ACT in fair condition. LRC Office 120 | Interiors | Interior Construction | Suspended Ceiling Construction | g Acoustical Suspended Ceilings | 2-Should Do | Fair 2 | 248 | \$8 | Square Foot | \$1,860 |








| Assessmen | Campus | Linked Bldg System | Addition | Room | Assessment Year | Assessment Status | Description | Building System L1 | Building System L2 | Building System L3 | Building System L4 | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|-----------|-----------------------|---|----------|-----------------------------|--------------------|------------------------|--|-----------------------|--|--|-------------------------------------|--------------|--------------------|----------|-----------|-----------------|----------------|
| 3928 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | | Toilets | | Sent to Maintenance | HM door frames are fair. Faculty Toilet 126 Prep surface and provide new paint | Interiors | Interior Construction | | Interior Swinging Doors | 2-Should Do | Fair | 1 | \$60 | Each | \$60 |
| 3939 | Hoover-Wood | 1091 - Interior | | Storage | 2020 | Sent to | finish at frame. Paint is fair. | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 2-Should Do | Fair | 524 | \$1 | Square Foot | \$472 |
| | School | Wall Finish, Paint | | | | Maintenance | Storage 219 | | | | Coating | | | | | | |
| 3940 | Hoover-Wood | 883 - Ceilings, | | Storage | 2020 | Sent to | ACT fair. | Interiors | Interior | Suspended Ceiling | Acoustical | 2-Should Do | Fair | 800 | \$8 | Square Foot | \$6,000 |
| | School | Acoustical Suspended Systems | | | | Maintenance | Storage 152, 150, 119, 131 | | Construction | | Suspended Ceilings | | | | | | |
| 3943 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Storage | 2020 | Sent to Maintenance | Wall base in fair condition. Storage 152, 150, 119, 131 | Interiors | Interior Finishes | Wall Finishes | | 2-Should Do | Fair | 120 | \$6 | Linear Foot | \$720 |
| 5584 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Storage | 2020 | Sent to Maintenance | CMU in fair condition - cracked at doorway, 7LF. Storage 119 | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 2-Should Do | Fair | 7 | \$15 | Linear Foot | \$105 |
| 5585 | Hoover-Wood | 915 - Plumbing, | | Boys 123 | 2020 | Sent to | Cost is to repair cracking only. Toilet fixtures in fair condition, one | Services | Plumbing | Domestic Water | Plumbing Fixtures | 2-Should Do | Fair | 6 | \$2,000 | Each | \$12,000 |
| | School | Plumbing Fixtures | | | | Maintenance | in poor condition. See photo. Boys 123 (Includes 3 WC and 3 urinals) | | | Distribution | | | | | | | |
| 6199 | Hoover-Wood School | 910 - HVAC, Distribution- Hydronic | | | 2020 | Sent to Maintenance | Per Capital Project Plan - pumps scheduled for replacement in 2020. | Services | Heating, Ventilation, and Air Conditioning (HVAC) | Facility HVAC Distribution Systems | Facility Hydronic Distribution | 2-Should Do | Good | 1 | \$32,000 | Lump Sum | \$32,000 |
| 7964 | Hoover-Wood School | 915 - Plumbing, Plumbing Fixtures | | Boys 161 | 2020 | Sent to Maintenance | Toilet fixtures fair in Boys 161 (Includes 2 WC & 2 urinals) | Services | Plumbing | Domestic Water Distribution | Plumbing Fixtures | 2-Should Do | Fair | 4 | \$2,000 | Each | \$8,000 |
| 3425 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Admin Suite, Nurse Suite | 2020 | Sent to Maintenance | Ceiling are in generally good condition, one or two tiles with water staining. Admin Suite, Nurse Suite | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 3200 | \$8 | Square Foot | \$24,000 |
| 3471 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Corridors | 2020 | Sent to Maintenance | generally good condition throughout corridors. | Interiors | Interior Construction | | Acoustical Suspended Ceilings | 3-Like To Do | Good | 5200 | \$8 | Square Foot | \$39,000 |
| 3607 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Instructional Spaces | 2020 | Sent to Maintenance | ACT good, minimal damage (ripped, water damage, discoloration, etc) Rooms: 208, 212, 207, 206, 211, 205, 204, 203, 210, 201 | | Interior Construction | | Acoustical Suspended Ceilings | 3-Like To Do | Good | 6100 | \$8 | Square Foot | \$45,750 |
| 3608 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Corridors | 2020 | Sent to Maintenance | generally good condition throughout 2nd floor corridors. | Interiors | Interior Construction | | Acoustical Suspended Ceilings | 3-Like To Do | Good | 1500 | \$8 | Square Foot | \$11,250 |



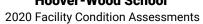



| Assessment | Campus | Linked Bldg | Addition | Room | Assessmen | | Description | | Building System | | | n Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|------------|-----------------------|---|----------|----------------------------|-----------|------------------------|--|-----------|--|-----------------------------------|---------------------------------------|--------------|---------------------------|----------|-----------|-----------------|----------------|
| ID | | System | | | Year | Status | | L1 | L2 | L3 | L4 | | | | | | |
| 3609 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Instructional Spaces | 2020 | Sent to Maintenance | ACT good, minimal damage (ripped, water damage, discoloration, etc) Rooms: 165, 164, 163, 159, 155, 135, | | Interior Construction | Suspended Ceiling Construction | g Acoustical Suspended Ceilings | 3-Like To Do | Good | 16000 | \$8 | Square Foot | \$120,000 |
| | | | | | | | 134, 108, 109, 115, 110, 107, 106, 105, 113, 104, 112, 103, 102, 101, 141, 130, 124, 125, 120, 129, 128, Computer Lab 118 | | | | | | | | | | |
| 3610 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Storage 145, Copier 158 | 2020 | Sent to Maintenance | ACT generally good. Storage 145, Copier 158 | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 130 | \$8 | Square Foot | \$975 |
| 3611 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Storage 218 | 2020 | Sent to Maintenance | ACT generally good. Storage 218 | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 123 | \$8 | Square Foot | \$923 |
| 3613 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Multipurpose Room | 2020 | Sent to Maintenance | Multipurpose Room ACT good | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 2188 | \$8 | Square Foot | \$16,410 |
| 3614 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Kitchen | 2020 | Sent to Maintenance | Kitchen ceiling good | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 242 | \$8 | Square Foot | \$1,815 |
| 3666 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Copier 158 | 2020 | Sent to Maintenance | ACT in good condition in Copier 158. | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 79 | \$8 | Square Foot | \$593 |
| 3915 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Library | 2020 | Sent to Maintenance | ACT in good condition. Library | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 2436 | \$8 | Square Foot | \$18,270 |
| 3933 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Faculty Toilets | 2020 | Sent to Maintenance | ACT is in good condition. Faculty Toilets 139, 140, 132, 126 | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 200 | \$8 | Square Foot | \$1,500 |
| 3934 | Hoover-Wood School | 883 - Ceilings, Acoustical Suspended Systems | | Faculty Toilets | 2020 | Sent to Maintenance | ACT is in good condition. Faculty Toilets 217 | Interiors | Interior Construction | Suspended Ceiling Construction | Acoustical Suspended Ceilings | 3-Like To Do | Good | 50 | \$8 | Square Foot | \$375 |
| 6196 | Hoover-Wood School | 793 - HVAC, Cooling-Chiller | | | 2020 | Sent to Maintenance | Per Capital Projects Plan - replace chiller in 2023. | Services | Heating, Ventilation, and Air Conditioning (HVAC) | Cooling Systems | Central Cooling | 3-Like To Do | Good | 1 | \$175,000 | Each | \$175,000 |
| | Hoover-Wood School | 792 - HVAC, Ventilation-AHU | | | 2020 | Sent to Maintenance | Per Capital Projects Plan - scheduled for replacement in 2025. AHU#1 (Multi-purpose Room) AHU#2 (Gym) AHU#3 (Admin Offices) AHU #4 (LRC) | Services | Heating, Ventilation, and Air Conditioning (HVAC) | Ventilation | Supply Air | 3-Like To Do | Good | 1 | \$230,000 | Lump Sum | \$230,000 |


Building Our Future
TOGETHER
BPS
101





| Assessment | Campus | Linked Bldg | Addition Room | Assessment | Assessment | Description | Building System | Building System | Building System | Building System | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|------------|-------------|--------------------|---------------|------------|-------------|---|-----------------|-------------------|-------------------|-------------------|--------------|---------------------------|----------|-----------|-----------------|----------------|
| ID | | System | | Year | Status | | L1 | L2 | L3 | L4 | | | | | | |
| 6198 | Hoover-Wood | 888 - Roofing, | | 2019 | Sent to | Built-up roof (BUR) and gravel. | Shell | Exterior | Roofing | Low-Slope | 3-Like To Do | Good | 46266 | \$30 | Square Foot | \$1,387,980 |
| | School | Low Slope | | | Maintenance | | | Horizontal | | Roofing | | | | | | |
| | | | | | | Upon inspection found roof | | Enclosures | | | | | | | | |
| | | | | | | membrane to be in fair condition | | | | | | | | | | |
| | | | | | | and performing as designed. | | | | | | | | | | |
| | | | | | | Inspected penetrations, wall | | | | | | | | | | |
| | | | | | | flashings, perimeter edge metal and | | | | | | | | | | |
| | | | | | | drains. Deficiencies found during | | | | | | | | | | |
| | | | | | | this inspection were repaired while | | | | | | | | | | |
| | | | | | | on site. Periodic visual roof | | | | | | | | | | |
| | | | | | | inspections & routine maintenance | | | | | | | | | | |
| | | | | | | can increase the long term service | | | | | | | | | | |
| | | | | | | life of this roof assembly. | | | | | | | | | | |
| 6200 | Hoover-Wood | 790 - HVAC, Boiler | | 2020 | Sent to | Per Capital Project Plan - boiler plant | Services | Heating, | Heating Systems | Heat Generation | 3-Like To Do | Good | 2 | \$125,000 | Each | \$250,000 |
| | School | Plant | | | Maintenance | scheduled for replacement in 2025. | | Ventilation, and | | | | | | | | |
| | | | | | | | | Air Conditioning | | | | | | | | |
| | | | | | | | | (HVAC) | | | | | | | | |
| 3400 | Hoover-Wood | 779 - Exterior | Exterior | 2020 | Sent to | Overall good condition throughout | Shell | Exterior Vertical | Exterior Walls | Exterior Wall | 4-Future | Good | 100 | \$5 | Square Foot | \$500 |
| | School | Face Brick | | | Maintenance | school. | | Enclosures | | Veneer | | | | | | |
| | | | | | | Minor issues: | | | | | | | | | | |
| | | | | | | -efflorescence only at trash | | | | | | | | | | |
| | | | | | | enclosure | | | | | | | | | | |
| | | | | | | -missing brick veneer at plan | | | | | | | | | | |
| | | | | | | southwest gym door by lintel | | | | | | | | | | |
| | | | | | | -one broken brick at base of gym | | | | | | | | | | |
| | | | | | | wall near southwest gym door | | | | | | | | | | |
| | | | | | | -water staining at water hookup | | | | | | | | | | |
| | | | | | | (10sf) | | | | | | | | | | |
| 3401 | Hoover-Wood | 891 - Exterior | Exterior | 2020 | Sent to | All good throughout school | Shell | Exterior Vertical | Exterior Louvers | | 4-Future | Good | 0 | \$0 | Each | \$0 |
| | School | Louvers and | | | Maintenance | | | Enclosures | and Vents | | | | | | | |
| 3409 | Hoover-Wood | 907 - Sitework, | Exterior | 2020 | Sent to | Concrete paving generally in good | Sitework | Site | Pedestrian Plazas | Pedestrian | 4-Future | Good | 100 | \$10 | Square Foot | \$1,000 |
| | School | Pedestrian | | | Maintenance | condition, some cracking. | | Improvements | and Walkways | Pavement | | | | | | |
| | | Pavement | | | | | | | | | | | | | | |
| 3416 | Hoover-Wood | 892 - Exterior | Exterior | 2020 | Sent to | Storefront windows and doors in | Shell | Exterior Vertical | Exterior Windows | Exterior Window | 4-Future | Good | 0 | \$100 | Square Foot | \$0 |
| | School | Window Wall | | | Maintenance | good condition throughout building. | | Enclosures | | Wall | | | | | | |
| 3420 | Hoover-Wood | 784 - Exterior | Exterior | 2020 | Sent to | Exterior HM doors and frames in | Shell | Exterior Vertical | Exterior Doors | Exterior Entrance | 4-Future | Good | 27 | \$2,600 | Each | \$70,200 |
| | School | Entrance Doors, | | | Maintenance | good condition. | | Enclosures | and Grilles | Doors | | | | | | |
| | | Hollow Metal | | | | | | | | | | | | | | |
| 3422 | Hoover-Wood | 783 - Exterior | Exterior | 2020 | Sent to | Exterior storefront doors in good | Shell | Exterior Vertical | Exterior Doors | Exterior Entrance | 4-Future | Good | 2 | \$7,500 | Each | \$15,000 |
| | School | Entrance Doors, | | | Maintenance | condition. | | Enclosures | and Grilles | Doors | | | | | | |
| | | Aluminum | | | | | | | | | | | | | | |
| 3423 | Hoover-Wood | 780 - Exterior | Admin | | Sent to | _ | Shell | Exterior Vertical | Exterior Windows | Exterior | 4-Future | Good | 154 | \$100 | Square Foot | \$15,400 |
| | School | Windows, | | | Maintenance | condition | | Enclosures | | Operating | | | | | | |
| | | Operating | | | | | | | | Windows | | | | | | |
| 3428 | Hoover-Wood | 787 - Interior | Admin Suite | 2020 | Sent to | Wood doors and HM frames in | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 6 | \$1,950 | Each | \$11,700 |
| | School | Doors, Swinging- | | | Maintenance | generally good condition. Door into | | Construction | | Doors | | | | | | |
| | | Wood | | | | Office 180 from school is slightly | | | | | | | | | | |
| | | | | | | more beat up than doors within | | | | | | | | | | |
| | | | | | | office suite but not seriously | | | | | | | | | | |
| | | | | | | damaged. | | | | | | | | | | |
| 3434 | Hoover-Wood | 1091 - Interior | Admin Suite | | Sent to | Paint in good condition. Quantity | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 4-Future | Good | 3100 | \$2 | Square Foot | \$6,975 |
| | School | Wall Finish, Paint | | | Maintenance | reflects space SF. | | | | Coating | | | | | | |
| | | | | | | | | | | | | | | | | |
| 1 | | | | | | Admin Suite | | | | | | | | | | |




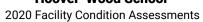





| Assessmen ID | t Campus | Linked Bldg System | Addition | Room | Assessment Year | Assessment Status | Description | Building System L1 | Building System L2 | Building System L3 | Building System L4 | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|-----------------|-----------------------|--|----------|--------------------------------|--------------------|------------------------|---|---------------------------|--------------------------|-----------------------|------------------------------|----------|--------------------|----------|-----------|-----------------|----------------|
| 3436 | Hoover-Wood School | 901 - Fixed Equipment, Casework | , | Work Room 174 | 2020 | Sent to Maintenance | Casework in good condition in work room, one cabinet missing pull. | | Furnishings | Fixed Furnishings | | 4-Future | Good | 36 | \$800 | Linear Foot | \$28,800 |
| 3440 | Hoover-Wood School | 901 - Fixed Equipment, Casework | (| Conference 176 | 2020 | Sent to Maintenance | Casework in good condition. 176 | Equipment and Furnishings | Furnishings | Fixed Furnishings | Casework | 4-Future | Good | 15 | \$800 | Linear Foot | \$12,000 |
| 3444 | Hoover-Wood School | 922 - Interior Partitions, Fixed- GWB | , | Admin Suite | | Sent to Maintenance | No major damage to any GWB wall in Admin Suite. | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 4-Future | Good | 0 | \$0 | | \$0 |
| 3445 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Admin Suite | | Sent to Maintenance | CMU on interior side of exterior wall assembly in Office Suite looks good. Crack through one block at top of wall in Principal 179, see photo. | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 4-Future | Good | 1 | \$0 | Linear Foot | \$0 |
| 3446 | Hoover-Wood School | 786 - Interior Windows, Fixed | | Office 180 | 2020 | Sent to Maintenance | Interior fixed windows into office look good. | Interiors | Interior Construction | Interior Windows | Interior Fixed Windows | 4-Future | Good | 70 | \$45 | Square Foot | \$3,150 |
| 3447 | Hoover-Wood School | 786 - Interior Windows, Fixed | | Nurse 168 | | Sent to Maintenance | Interior windows to nurse looks good, some minor paint chipping on Office 180 side. | Interiors | Interior Construction | Interior Windows | Interior Fixed Windows | 4-Future | Good | 52 | \$45 | Square Foot | \$2,340 |
| 3456 | Hoover-Wood School | 1595 - Flooring, Resilient - LVT | | Faculty Lounge 173 | | Sent to Maintenance | New LVT flooring in excellent condition. | Interiors | Interior Finishes | Flooring | Resilient Flooring | 4-Future | Excellent | 684 | \$10 | Square Foot | \$6,840 |
| 3461 | Hoover-Wood School | 1143 - Interior Wall Finishes, Wall Base | | Faculty Lounge 173 | 2020 | Sent to Maintenance | Wall base looks new. 173 | Interiors | Interior Finishes | Wall Finishes | | 4-Future | Excellent | 109 | \$6 | Linear Foot | \$654 |
| 3485 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Storage | 2020 | Sent to Maintenance | CMU looks good, no noticeable cracking in Storage 152, 150, 119, 145 | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 4-Future | Good | 0 | \$0 | Square Foot | \$0 |
| 3605 | Hoover-Wood School | 903 - Flooring, Carpet | | Library, Library Office 120 | 2020 | Sent to Maintenance | Carpet looks recently replaced in Library and Office | Interiors | Interior Finishes | Flooring | Carpeting | 4-Future | Good | 2684 | \$7 | Square Foot | \$17,446 |
| 3626 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Instructional Spaces | 2020 | Sent to Maintenance | CMU generally good, no major cracking at exterior wall system. Rooms 212, 207, 206, 211, 205, 210 | Interiors | Interior Construction | Interior Partitions | Interior Fixed Partitions | 4-Future | Good | 0 | \$0 | | \$0 |
| 3627 | Hoover-Wood School | 782 - Interior Partitions, Fixed- CMU | | Instructional Spaces | | Sent to Maintenance | CMU generally good, no cracking at exterior wall system. Rooms 165, 164, 163, 159, 155, 135, 134, 108, 115, 110, 107, 106, 105, 113, 104, 112, 103, 102, 101, Computer Lab 118, 128, 124, 129, 125 | | Interior Construction | Interior Partitions | Interior Fixed Partitions | 4-Future | Good | 0 | \$0 | | \$0 |
| 3635 | Hoover-Wood School | 901 - Fixed Equipment, Casework | | Instructional Spaces | | Sent to Maintenance | Casework good, hardly any damage. Rooms 159, 134, 108, 105, 102, 118 | Equipment and Furnishings | Furnishings | Fixed Furnishings | Casework | 4-Future | Good | 200 | \$800 | Linear Foot | \$160,000 |
| 3644 | Hoover-Wood School | 787 - Interior Doors, Swinging- Wood | 9 | Storage 145 | 2020 | Sent to Maintenance | Door and frame in good condition at Storage 145 | Interiors | Interior Construction | | Interior Swinging Doors | 4-Future | Good | 1 | \$1,950 | Each | \$1,950 |

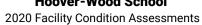





| Assessment | Campus | Linked Bldg | Addition Room | Assessmer | nt Assessment | Description | Building System | Building System | Building System | Building System | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|------------|-----------------------|----------------------------------|----------------|-----------|------------------------|---|-----------------|-------------------|-----------------|-------------------|-----------|--------------------|----------|-----------|-----------------|----------------|
| ID | | System | Addition Room | Year | Status | Description | L1 | L2 | L3 | L4 | inonty | Tuellity Condition | quantity | Sinc cost | ome or measure | 25timated cost |
| 3645 | Hoover-Wood | 915 - Plumbing, | Girls 162, Gir | s 2014 | Sent to | Girls 162, 122 | Services | Plumbing | Domestic Water | Plumbing Fixtures | 4-Future | Good | 10 | \$2,000 | Each | \$20,000 |
| | School | Plumbing Fixtures | 122 | | Maintenance | Day 2014 II / I C Daysort Thousans are | | | Distribution | | | | | | | |
| | | | | | | Per 2014 H/LS Report - There are an adequate number of fixtures in the | | | | | | | | | | |
| | | | | | | building to meet the requirements | | | | | | | | | | |
| | | | | | | of the Illinois Plumbing Code. The | | | | | | | | | | |
| | | | | | | plumbing fixtures range from fair to | | | | | | | | | | |
| | | | | | | new condition and appear to be | | | | | | | | | | |
| | | | | | | operating correctly. The lavatories, | | | | | | | | | | |
| | | | | | | urinals, and water closets are wall | | | | | | | | | | |
| | | | | | | mounted. | | | | | | | | | | |
| | | | | | | | | | | | | | | | | |
| | | | | | | Cost is for water closet replacement | | | | | | | | | | |
| 3646 | Hoover-Wood | 909 - Interior | Girls 162, Gir | s 2020 | Sent to | Toilet partitions in good condition | Interiors | Interior | Interior | Toilet, Bath, and | 4-Future | Good | 10 | \$1,800 | Each | \$18,000 |
| | School | Specialties, Toilet | 122 | | Maintenance | | | Construction | Specialties | Laundry | | | | | | |
| | | Compartments | | | | Girls 162, 122 | | | | Accessories | | | | | | |
| | | | | | | Cook in the woodle on montification of the | | | | | | | | | | |
| | | | | | | Cost is to replace partitions w/solid phenolic (SPCP) | | | | | | | | | | |
| 3647 | Hoover-Wood | 909 - Interior | Boys 214, Gir | s 2020 | Sent to | Toilet partitions in good condition | Interiors | Interior | Interior | Toilet, Bath, and | 1-Future | Good | 9 | \$1,800 | Each | \$16,200 |
| 3047 | School | Specialties, Toilet | 213 | 3 2020 | Maintenance | Tonet partitions in good condition | interiors | Construction | Specialties | Laundry | 4-1 uture | dood | , | \$1,000 | Lacii | 710,200 |
| | 3011001 | Compartments | 213 | | iviaintenance | Boys 214, Girls 213 | | Construction | Specialities | Accessories | | | | | | |
| | | | | | | | | | | | | | | | | |
| | | | | | | Cost is to replace partitions w/solid | | | | | | | | | | |
| | | | | | | phenolic (SPCP) | | | | | | | | | | |
| 3648 | Hoover-Wood | 915 - Plumbing, | Boys 214, Gir | s 2014 | Sent to | Boys 214, Girls 213 | Services | Plumbing | Domestic Water | Plumbing Fixtures | 4-Future | Good | 12 | \$2,000 | Each | \$24,000 |
| | School | Plumbing Fixtures | 213 | | Maintenance | (Includes 9 WC and 3 urinals) | | | Distribution | | | | | | | |
| | | | | | | | | | | | | | | | | |
| | | | | | | Per 2014 H/LS Report - There are an | | | | | | | | | | |
| | | | | | | adequate number of fixtures in the | | | | | | | | | | |
| | | | | | | building to meet the requirements | | | | | | | | | | |
| | | | | | | of the Illinois Plumbing Code. The | | | | | | | | | | |
| | | | | | | plumbing fixtures range from fair to new condition and appear to be | | | | | | | | | | |
| | | | | | | operating correctly. The lavatories, | | | | | | | | | | |
| | | | | | | urinals, and water closets are wall | | | | | | | | | | |
| | | | | | | mounted. | | | | | | | | | | |
| | | | | | | ca. | | | | | | | | | | |
| | | | | | | Cost is for water closet replacement | | | | | | | | | | |
| 3650 | Hoover-Wood | 1597 - Interior | All Toilets | 2020 | Sent to | Wall tile generally good (good at top | | Interior Finishes | Wall Finishes | Tile Wall Finish | 4-Future | Good | 800 | \$30 | Square Foot | \$24,000 |
| | School | Wall Finish - | | | Maintenance | part of wall, dirty or cracked at base | | | | | | | | | | |
| | | Ceramic Tile | | | | of wall). Tile estimated to be 4'-0" | | | | | | | | | | |
| | | | | | | AFF - VIF. | | | | | | | | | | |
| | | | | | | | | | | | | | | | | |
| 2054 | Hanson Maria | 1507 Interior | AH T-11-1 | 2020 | Court to | Girls 162, Boys 123, Girls 122, | Intorious | Interior Civilet | Mall Figirles | Tile Well State | 4 5 | Cand | 700 | 620 | Causas Frat | ¢34.000 |
| 3651 | Hoover-Wood School | 1597 - Interior Wall Finish - | All Toilets | 2020 | Sent to Maintenance | Wall tile generally good (good at top part of wall, dirty or cracked at base | | Interior Finishes | Wall Finishes | Tile Wall Finish | 4-Future | Good | 700 | \$30 | Square Foot | \$21,000 |
| | SCHOOL | Ceramic Tile | | | Maintenance | of wall). | | | | | | | | | | |
| | | Ceraiiiic Tile | | | | or waiij. | | | | | | | | | | |
| | | | | | | Boys 214, Girls 213 | | | | | | | | | | |
| 3655 | Hoover-Wood | 787 - Interior | Stage | 2020 | Sent to | Wood door in good condition to | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 2 | \$1,950 | Each | \$3,900 |
| | School | Doors, Swinging- | 0 | | Maintenance | | | Construction | | Doors | | | | | | |
| | | Wood | | | | | | | | | | | | | | |
| 3657 | Hoover-Wood | 787 - Interior | Gym | 2020 | Sent to | Interior doors and frames to gym in | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 7 | \$1,950 | Each | \$13,650 |
| | School | Doors, Swinging- | | | Maintenance | good condition | | Construction | | Doors | | | | | | |
| 1 | | Wood | | | | | | | | | | | | | | |





| ssessmen | Campus | Linked Bldg | Addition | Room | Assessmer | nt Assessment | Description | Building System | Building System | Building System | Building System | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cost |
|----------|-----------------------|------------------------------------|----------|-------------------------|-----------|------------------------|---|-----------------|--------------------------|---------------------|-------------------------|-----------|--------------------|----------|-------------|------------------|----------------|
| ID | Campus | System | Addition | KOOIII | Year | Status | Description | L1 | L2 | L3 | L4 | Priority | racinty Condition | Quantity | Offic Cost | Offic Of Weasure | Estimateu Cost |
| 3660 | Hoover-Wood | 781 - Exterior | | Gym | 2020 | Sent to | Windows in good condition. | Shell | Exterior Vertical | Exterior Windows | | 4-Future | Good | 0 | \$90 | Square Foot | \$0 |
| 3000 | School | Windows, Fixed | | Gyiii | 2020 | Maintenance | willdows ill good collaition. | Sileii | Enclosures | Exterior willdows | Windows | 4-1 uture | Good | O | \$30 | Square root | 50 |
| 3661 | Hoover-Wood | 1091 - Interior | | Gym | 2020 | Sent to | Paint generally good, could be | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 1-Future | Good | 4391 | \$2 | Square Foot | \$9,880 |
| 3661 | School | Wall Finish, Paint | | Gyiii | 2020 | Maintenance | repainted near bottom of wall and | litteriors | interior rinishes | vvaii i iiiisiies | Coating | 4-1 uture | Good | 4391 | ŞΖ | Square root | 75,000 |
| | 3011001 | vvan i misn, i amic | | | | Widiliteriance | near pull up bars. | | | | Coating | | | | | | |
| 3663 | Hoover-Wood | 782 - Interior | | Gym | 2020 | Sent to | CMU in good condition in gym. | Interiors | Interior | Interior Partitions | Interior Fixed | 4-Future | Good | n | \$0 | | \$0 |
| 3665 | School | Partitions, Fixed- | | Gyiii | 2020 | Maintenance | civio in good condition in gym. | interiors | Construction | interior rartitions | Partitions | 4 Tuture | Good | Ü | Ç. | | 70 |
| | 3011001 | CMU | | | | Widiliteriance | | | Construction | | T at titions | | | | | | |
| | Hoover-Wood | 1091 - Interior | | Copier 158 | 2020 | Sent to | Paint good, no major scuffs or | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 4-Future | Good | 79 | \$2 | Square Foot | \$178 |
| 3005 | School | Wall Finish, Paint | | copici 130 | 2020 | Maintenance | damage. | interiors | interior rinishes | vvaii i iiiisiies | Coating | 4 Tuture | Good | ,, | 72 | Square root | 7170 |
| | 3611001 | vvan i misn, i ame | | | | iviaiiiteilailee | Copier 158 | | | | Couring | | | | | | |
| 3899 | Hoover-Wood | 787 - Interior | | Kitchen | 2020 | Sent to | Doors in good condition. | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 2 | \$1,950 | Each | \$3,900 |
| 3033 | School | Doors, Swinging- | | Riterien | 2020 | Maintenance | Kitchen | interiors | Construction | interior boors | Doors | 4 Tuture | Good | _ | 71,330 | Lucii | 73,300 |
| | 3011001 | Wood | | | | Widiliteriance | Richell | | Construction | | D0013 | | | | | | |
| 3900 | Hoover-Wood | 788 - Interior | | Kitchen | 2020 | Sent to | Coiling door at serving window in | Interiors | Interior | Interior Doors | Interior Coiling | 4-Future | Good | 1 | \$2,000 | Each | \$2,000 |
| 3300 | School | Doors, Coiling | | Medicii | 2020 | Maintenance | good condition. | interiors | Construction | meerior boors | Doors | 1 Tuture | 0000 | - | 72,000 | Lucii | 72,000 |
| | 3611001 | 20013, coming | | | | Widirectionee | Kitchen | | construction | | 20013 | | | | | | |
| 3908 | Hoover-Wood | 903 - Flooring, | | Library, Library | 2020 | Sent to | Carpet looks recently replaced in | Interiors | Interior Finishes | Flooring | Carpeting | 4-Future | Good | 2684 | \$7 | Square Foot | \$17,446 |
| 3300 | School | Carpet | | Office 120 | 2020 | Maintenance | Library and Office 120 | interiors | meerior rimanes | 110011116 | carpeting | 1 Tuture | 0000 | 2001 | Ψ, | Squareroot | Ψ17,110 |
| 3913 | Hoover-Wood | 901 - Fixed | | Library Office 120 | 0 2020 | Sent to | Casework in good condition. | Equipment and | Furnishings | Fixed Furnishings | Casework | 4-Future | Good | 20 | \$800 | Linear Foot | \$16,000 |
| | School | Equipment, | | 2.3.4.7 566 22. | 5 2525 | Maintenance | Office 120 | Furnishings | | · mea · a·····go | Casework | | 3334 | | 4000 | 2 | Ψ20,000 |
| | 3611001 | Casework | | | | Widirectionee | 5111cc 125 | 1 4111131111183 | | | | | | | | | |
| 3916 | Hoover-Wood | 781 - Exterior | | Library | 2020 | Sent to | Exterior windows in good condition | Shell | Exterior Vertical | Exterior Windows | Exterior Fixed | 4-Future | Good | 136 | \$90 | Square Foot | \$12,240 |
| 3310 | School | Windows, Fixed | | Library | 2020 | Maintenance | Library | . Silen | Enclosures | Exterior villagus | Windows | 1 Tuture | 0000 | 100 | 430 | Squareroot | 712,210 |
| 3917 | Hoover-Wood | 922 - Interior | | Library | 2020 | Sent to | Soffits in excellent condition, look | Interiors | Interior | Interior Partitions | | 4-Future | Excellent | 0 | \$0 | | \$0 |
| 3317 | School | Partitions, Fixed- | | 2.2. 0. 7 | | Maintenance | recently re-painted. | | Construction | cc.ro. r di titolo | Partitions | | ZAGENENE | | 4 • | | Ψ. |
| | 30.100. | GWB | | | | ···aco | Library | | | | | | | | | | |
| 3918 | Hoover-Wood | 1143 - Interior | | Library Office 120 | 0 2020 | Sent to | Wall base in good condition. | Interiors | Interior Finishes | Wall Finishes | | 4-Future | Good | 63 | \$6 | Linear Foot | \$378 |
| 3916 | School | Wall Finishes, | | 2.3.4.7 566 22. | 5 2525 | Maintenance | Office 120 | | | | | | 3334 | | 70 | 2 | φσ.σ |
| | 30.130. | Wall Base | | | | | 0.1100 120 | | | | | | | | | | |
| 3919 | Hoover-Wood | 1143 - Interior | | Instructional | 2020 | Sent to | Wall base in good condition. | Interiors | Interior Finishes | Wall Finishes | | 4-Future | Good | 125 | \$6 | Linear Foot | \$750 |
| | School | Wall Finishes, | | Spaces | | Maintenance | Rooms 129, 128, 124, 125 | | | | | | | | , - | | , |
| | 30.130. | Wall Base | | Spaces | | | | | | | | | | | | | |
| 3920 | Hoover-Wood | 787 - Interior | | Instructional | 2020 | Sent to | Doors in generally good condition. | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 30 | \$1,950 | Each | \$58,500 |
| | School | Doors, Swinging- | | Spaces | | Maintenance | Rooms 130, 129, 128, 124, 125, | | Construction | | Doors | | | | 7 - 70 0 0 | | 7-5,-55 |
| | | Wood | | 5,5355 | | | Computer Lab 118, 165, 164, 163, | | | | | | | | | | |
| | | | | | | | 159, 155, 135, 134, 108, 109, 115, | | | | | | | | | | |
| | | | | | | | 110, 107, 106, 105, 113, 104, 112, | | | | | | | | | | |
| | | | | | | | 103, 102, 101 | | | | | | | | | | |
| 3922 | Hoover-Wood | 922 - Interior | | Instructional | 2020 | Sent to | GWB in good condition, no major | Interiors | Interior | Interior Partitions | Interior Fixed | 4-Future | Good | 0 | \$0 | | \$0 |
| 3923 | School | Partitions, Fixed- | | Spaces | | Maintenance | | | Construction | cc.ro. r di titolo | Partitions | | 3334 | | 4 • | | Ψ. |
| | | GWB | | Брисси | | | Reading 129, Instructional Coach | | | | | | | | | | |
| | Hoover-Wood | 1091 - Interior | | Instructional | 2020 | Sent to | Paint in fair condition. | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 4-Future | Good | 544 | \$2 | Square Foot | \$1,224 |
| | School | Wall Finish, Paint | | Spaces | | Maintenance | Rooms 130, 129, 128 | | | | Coating | | | | T - | | 7 -/ : |
| 3924 | Hoover-Wood | 787 - Interior | | Faculty Toilets | 2020 | Sent to | Doors are good. | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 4 | \$1,950 | Each | \$7,800 |
| 3324 | School | Doors, Swinging- | | , , , , , , , , , , , , | | | Faculty Toilets 139, 140, 132, 126 | | Construction | | Doors | | | | . , | | , , |
| | - 5 | Wood | | | | | 233, 233, 233, 232, 220 | | | | 2 | | | | | | |
| 3925 | Hoover-Wood | 787 - Interior | | Faculty Toilets | 2020 | Sent to | Doors are good. | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 1 | \$1,950 | Each | \$1,950 |
| | School | Doors, Swinging- | | , , , , , , , , , , , , | | Maintenance | Faculty Toilet 217 | | Construction | | Doors | | | | . , | | , , |
| | | Wood | | | | | , | | | | | | | | | | |
| 3926 | Hoover-Wood | 787 - Interior | | Faculty Toilets | 2020 | Sent to | HM door frames are good. | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 3 | \$1,950 | Each | \$5,850 |
| 3920 | School | Doors, Swinging- | | | | Maintenance | Faculty Toilets 139, 140, 132 | | Construction | 200.0 | Doors | | | - | , -, | | , |
| | 1 | Wood | | | | | , | | | | | | | | | | |
| | | | | (| 1 | _ | 1 | | + | + | 1 | + | | | | 1 | 1 |
| 3927 | Hoover-Wood | | | Faculty Toilets | 2020 | Sent to | HM door frames are good. | Interiors | Interior | Interior Doors | Interior Swinging | 4-Future | Good | 1 | \$1.950 | Each | S1.950 |
| 3927 | Hoover-Wood School | 787 - Interior Doors, Swinging- | | Faculty Toilets | 2020 | Sent to Maintenance | HM door frames are good. Faculty Toilet 217 | Interiors | Interior Construction | Interior Doors | Interior Swinging Doors | 4-Future | Good | 1 | \$1,950 | Each | \$1,950 |







| Assessment | Campus | Linked Bldg | Addition | Room | Assessment | Assessment | Description | Building System | Building System | Building System | Building System | Priority | Facility Condition | Quantity | Unit Cost | Unit Of Measure | Estimated Cos |
|------------|-------------|--------------------|----------|-----------------|------------|-------------|-------------------------------------|------------------------|------------------------|------------------------|------------------------|----------|---------------------------|----------|-----------|-----------------|---------------|
| ID | | System | | | Year | Status | | L1 | L2 | L3 | L4 | | | | | | |
| 3929 | Hoover-Wood | 782 - Interior | | Faculty Toilets | 2020 | Sent to | CMU is good. | Interiors | Interior | Interior Partitions | Interior Fixed | 4-Future | Good | 0 | \$0 | | \$0 |
| | School | Partitions, Fixed- | | | | Maintenance | Faculty Toilet 139, 140, 132, 126 | | Construction | | Partitions | | | | | | |
| | | CMU | | | | | | | | | | | | | | | |
| 3930 | Hoover-Wood | 782 - Interior | | Faculty Toilets | 2020 | Sent to | CMU is good. | Interiors | Interior | Interior Partitions | Interior Fixed | 4-Future | Good | 1 | \$0 | | \$0 |
| | School | Partitions, Fixed- | | | | Maintenance | Faculty Toilet 217 | | Construction | | Partitions | | | | | | |
| | | CMU | | | | | | | | | | | | | | | |
| 3931 | Hoover-Wood | 1091 - Interior | | Faculty Toilets | 2020 | Sent to | Paint is in good condition. | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 4-Future | Good | 52 | \$2 | Square Foot | \$117 |
| | School | Wall Finish, Paint | | | | Maintenance | Faculty Toilet 217 | | | | Coating | | | | | | |
| 3932 | Hoover-Wood | 1091 - Interior | | Faculty Toilets | 2020 | Sent to | Paint is in good condition. | Interiors | Interior Finishes | Wall Finishes | Wall Painting and | 4-Future | Good | 200 | \$2 | Square Foot | \$450 |
| | School | Wall Finish, Paint | | | | Maintenance | Faculty Toilets 139, 140, 132, 126 | | | | Coating | | | | | | |
| 3937 | Hoover-Wood | 1143 - Interior | | Faculty Toilets | 2020 | Sent to | Wall base is in good condition. | Interiors | Interior Finishes | Wall Finishes | | 4-Future | Good | 30 | \$6 | Linear Foot | \$180 |
| | School | Wall Finishes, | | | | Maintenance | Faculty Toilet 217 | | | | | | | | | | |
| | | Wall Base | | | | | | | | | | | | | | | |
| 3938 | Hoover-Wood | 1143 - Interior | | Faculty Toilets | 2020 | Sent to | Wall base is in good condition. | Interiors | Interior Finishes | Wall Finishes | | 4-Future | Good | 120 | \$6 | Linear Foot | \$720 |
| | School | Wall Finishes, | | | | Maintenance | Faculty Toilet 139, 140, 132, 126 | | | | | | | | | | |
| | | Wall Base | | | | | | | | | | | | | | | |
| 11697 | Hoover-Wood | 11495 - Casework, | | | 2020 | Sent to | Approx 12 LF of 6" cubbies in 21 | Equipment and | Furnishings | Fixed Furnishings | Casework | 4-Future | Good | 342 | \$175 | Linear Foot | \$59,850 |
| | School | Cubbies | | | | Maintenance | classrooms; 30 LF in 3 classrooms | Furnishings | | | | | | | | | |
| 17573 | Hoover-Wood | 780 - Exterior | | Music, Art, | 2020 | Sent to | Rooms: 155, 159, 163, 164, 165 | Shell | Exterior Vertical | Exterior Windows | Exterior | 4-Future | Good | 489 | \$100 | Square Foot | \$48,900 |
| | School | Windows, | | Special Ed | | Maintenance | | | Enclosures | | Operating | | | | | | |
| | | Operating | | | | | | | | | Windows | | | | | | |
| 17574 | Hoover-Wood | 780 - Exterior | | | | Sent to | Rooms: 101, 102, 103, 104, 105, 106 | 5, Shell | Exterior Vertical | Exterior Windows | | 4-Future | Good | 1210 | \$100 | Square Foot | \$121,000 |
| | School | Windows, | | | | Maintenance | 107, 108, 109, 110, 133,134,135, | | Enclosures | | Operating | | | | | | |
| | | Operating | | | | | Media Center | | | | Windows | | | | | | |
| 17575 | Hoover-Wood | | | Classrooms | 2020 | Sent to | Rooms: 201-208 | | | | | 4-Future | Good | 660 | \$100 | Square Foot | \$66,000 |
| | School | | | | | Maintenance | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | A |
| | | | | | | | | | | | | | | | | Total Cost | \$5,018,839 |
| | | | | | | | | | | | | | | | | Priority 1 | \$425,888 |
| | | | | | | | | | | | | | | | | Priority 2 | \$1,337,143 |